



AIRWORTHINESS DIRECTIVE

CIVIL AVIATION AUTHORITY
CZECH REPUBLIC
Airworthiness Division

Airport Ruzyně, 160 08 Prague 6
Tel: 420 233320922, fax: 420 220562270

Number: CAA-AD-063/2004

Date of issue: July 13, 2004

EMBRAER

EMB-145(), EMB-135()

This AD has been issued in accordance with Decision No.: 2/2003 of the Executive Director of the EASA (ADs issued by the state of design are automatically adopted in EU member states).

AIRCRAFT - TAT SENSOR HEATING - MODIFICATION

Applicability: all Embraer EMB-145() and EMB-135() aircraft models in operation.

Effective date: September 02, 2004

Compliance: Required as indicated DAC AD 2004-01-02R1.

Remarks: The compliance of this AD must be recorded in Aircraft Logbook, where applicable the requirements of this AD must be integrated into Aircraft Technical Documentation. Address inquiries concerning this AD to: Civil Aviation Authority, Airworthiness Division, Ruzyně Airport, 160 08 Prague 6, Czech Republic, tel.: 420 2 33320922, fax: 420 2 20562270.

Ing. Pavel MATOUŠEK
Director

BRAZILIAN AIRWORTHINESS DIRECTIVE
AD No.: 2004-01-02R1

EFFECTIVE DATE: 19 jul. 2004

The following Airworthiness Directive (AD), issued by the Departamento de Aviação Civil (DAC) in accordance with provisions of Chapter IV, Title III of Código Brasileiro de Aeronáutica - Law No. 7,565 dated 19 December 1986 - and Regulamento Brasileiro de Homologação Aeronáutica (RBHA) 39, applies to all aircraft registered in the Registro Aeronáutico Brasileiro. No person may operate an aircraft to which this AD applies, unless it has previously complied with the requirements established herein.

AD No. 2004-01-02R1 - EMBRAER - Amendment 39-1028.

APPLICABILITY:

This Airworthiness Directive is applicable to all Embraer EMB-145() and EMB-135() aircraft models in operation.

CANCELLATION / REVISION:

This AD cancels and supersedes the AD No. 2004-01-02, original issue – Amdt 39-1006, dated 27 jan. 2004, and is being issued to correct the electrical installations required by the previous applicable Service Bulletin issues.

REASON:

It has been found the occurrence of cases where, due to the TAT sensor heating on the ground, the FADEC has failed to increase engine thrust during take-off in order to compensate for the ice accretion at engine fan blades. That condition may lead to insufficient thrust to safely complete the take-off.

Since this condition may occur in other airplanes of the same type and affects flight safety, a corrective action is required. Thus, sufficient reason exists to request compliance with this AD in the indicated time limit.

REQUIRED ACTION:

Modification of the TAT sensor heating system.

COMPLIANCE:

Required as indicated below, unless already accomplished.

(a) Within the next 90 calendar days after 24 jan. 2004, the effective date of the original issue of this AD, modify the TAT sensor heating system according to Embraer Service Bulletin No. 145-30-0028 Rev. 04, or further revisions approved by the CTA.

(b) Within the next 90 calendar days after the effective date of this revision 01, modify the electrical installation of the TAT sensor heating system, if that installation has been done according to instructions of the revisions 04 thru 08 of the Embraer Service Bulletin No. 145-30-0028.

The detailed instructions and procedures to accomplish this AD are described in the Embraer Service Bulletin No. 145-30-0028 Rev. 09, or further revisions approved by the CTA.

Record compliance with this AD in the applicable maintenance log book.

CONTACT:

For additional technical information, contact:

Centro Técnico Aeroespacial - CTA
Instituto de Fomento e Coordenação Industrial - IFI
Divisão de Homologação Aeronáutica - FDH
Praça Mal. Eduardo Gomes, 50 - Vila das Acácias
Caixa Postal 6001

Fax: 55 (12) 3941-4766
12231-970 - São José dos Campos - SP, BRAZIL.
e-mail: pds@ifi.cta.br

For acquisition, contact:

Departamento de Aviação Civil - DAC
Seção de Publicações do DAC (4GAB-4)
R. Santa Luzia, 651, 2º Mezanino, Centro
Fax: 55 (21) 3814-6929
20030-040 - Rio de Janeiro - RJ, BRAZIL.
e-mail: publicacoes@dac.gov.br

APPROVAL:

CLÁUDIO PASSOS SIMÃO - Ten.-Cel.-Eng.
Chief of the Aeronautical Certification Division
IFI/CTA

VENÂNCIO ALVARENGA GOMES - Cel.-Eng.
Director of the Industrial Coordination and Fostering Institute
CTA

NOTE: Original in Portuguese language signed and available in the files of the Registro Geral de Aeronavegabilidade (RGA/TE-1/STE) of the Departamento de Aviação Civil.